

GAUMER PROCESS

HEATERS
SYSTEMS
CONTROLS

Magnetic Contactors


Type GEB - Definite Purpose

APPLICATIONS

Performs switching of loads on and off where either the thermostat contacts are not sufficient capacity or where three (3) phase power is being utilized.

STANDARD FEATURES

May be mounted in most any orientation, encapsulated coil, heavy duty weld resistant silver cadmium contacts, U.L. approved for resistance heating applications.

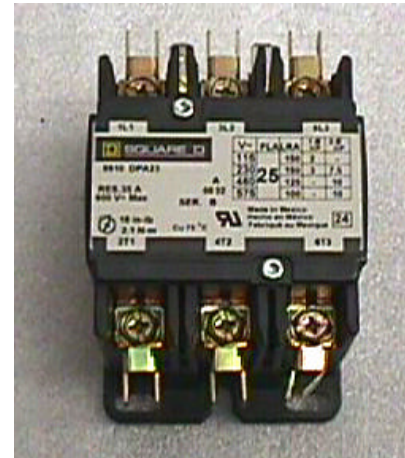

Catalog Number	Res. Rating (AMPS)	Motor Rating @480V	Motor Rating @240V	Height (Inches)	Depth (Inches)	Width (Inches)	FuseBlock Rating (Amps)	Weight (lbs.)
GEB230AA	30	3 HP	2 HP	3-3/4	3-1/2	2-5/8	none	2
GEB330AA	40	7-1/2 HP	5 HP	3-3/4	3-1/2	2-5/8	none	2
GEB430AA	50	15 HP	10 HP	3-3/4	3-1/2	2-5/8	none	3
GEB530AA	63	25 HP	15 HP	3-3/4	4	3-3/8	none	3
GEB630AA	75	30 HP	20 HP	5-1/8	4	3-3/8	none	3
GEB230AA-MFB	30	3 HP	2 HP	4-5/8	4	3-1/2	30	3
GEB330AA-JFB	40	7-1/2 HP	5 HP	5-3/8	5	4-3/4	60	3
GEB430AA-JFB	50	15 HP	10 HP	5-3/8	5	4-3/4	60	4
GEB530AA-JFB	63	25 HP	15 HP	5-3/8	5	4-3/4	60	4
GEB530BA	63	25 HP	15 HP	3-3/4	4	3-3/8	none	3
GEB730AA	94	40 HP	25 HP	5-1/8	4-3/4	3-3/8	none	5
GEB230BA	30	3 HP	2 HP	3-3/4	3-1/2	2-5/8	none	2
GEB330BA	40	7-1/2 HP	5 HP	3-3/4	3-1/2	2-5/8	none	2
GEB430BA	50	15 HP	10 HP	3-3/4	4	3-3/8	none	3
GEB630BA	75	30 HP	20 HP	5-1/8	4-3/4	3-3/8	none	4
GEB230BA-MFB	30	3 HP	2 HP	4-5/8	4	3-1/2	30	3
GEB330BA-JFB	40	7-1/2 HP	5 HP	5-3/8	5	4-3/4	60	3
GEB430BA-JFB	50	15 HP	10 HP	5-3/8	5	4-3/4	none	4
GEB530BA-JFB	63	25 HP	15 HP	5-3/8	5	4-3/4	60	4
GEB730BA	94	40 HP	25 HP	5-1/8	4-3/4	3-3/8	none	5
GEB930AA	120	50 HP	30 HP	5-1/8	4-3/4	3-3/8	none	7
GEB930BA	120	50 HP	30 HP	5-1/8	4-3/4	3-3/8	none	7